

QUICK CARD

CWDM Expert OTDR

This quick card explains how to connect to a fiber under test, configure EXPERT OTDR test settings using Quick Setup, run tests, and analyze results with a VIAVI T-BERD/MTS-5800 equipped with a 4100-series CWDM OTDR module.

 **Note: The CWDM OTDR module is used to test individual CWDM channels on a live network. Care must be taken to select and test the correct channel or wavelength.**

- ▶ T-BERD/MTS-5800 equipped with the following:
 - Fiber Optics Software Release V21.0 or greater
 - 4100 Series CWDM OTDR Module (E41CWDMC10L-APC, E41CWDMC10L-PC, E41CWDM10U-APC, E41CWDM10U-PC, E41CWDM8U-APC or E41CWDM8U-PC)
- ▶ Fiber optic cleaning and inspection tools
- ▶ 20-meter Fiber optic patch cable (Launch Cable)
- ▶ Optical Coupler to connect Launch Cable to Fiber Under Test



Figure 1: Equipment Requirements

- ▶ Use the VIAVI P5000i or FiberChek Probe microscope to inspect both sides of every connection being used (OCC Port, Launch Cable, bulkhead connectors, patch cables, etc.)
- ▶ Focus fiber on the screen. If dirty, clean the end-face.
- ▶ If it appears clean, run inspection test.
- ▶ If it fails, clean the fiber and re-run inspection test. Repeat until it passes.



Figure 2: Inspect Before You Connect

QUICK CARD

CONNECT TO FIBER UNDER TEST (FUT)

All fibers and connectors should be inspected and clean prior to connection, as described on page 1. The OTDR may be connected to the FUT via an optical patch panel (OPP) or a coupler:

1. Inspect the OTDR port on top of the test set.
2. Inspect the fiber end face of the Launch Cable.
3. Connect the Launch Cable to the OTDR port.
4. If the interface to the FUT is a patch cord, connect the patch cord to an optical coupler.
5. Inspect the fiber end face of the Launch Cable.
6. Connect the Launch Cable to the coupler or OPP.
7. Disconnect or disable the far end SFP on this channel/wavelength.



Figure 3: Inspecting the OTDR Port

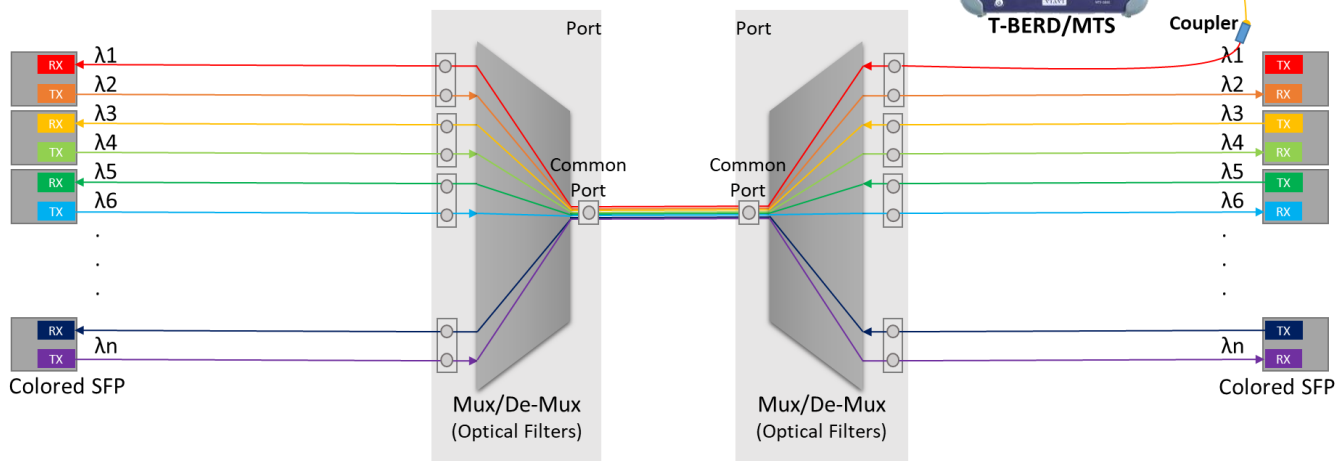


Figure 4: Connecting to the Fiber Under Test

LAUNCH TEST

1. Press the Power button  to start the test instrument.
2. Tap the **Fiber Optics** icon  in the Status Bar at the top of the screen.
3. If a purple  symbol is displayed on the left screen side, tap it to display the **Fiber Optics** home screen.
4. Tap the **OTDR SM** icon  until it is yellow and highlighted .

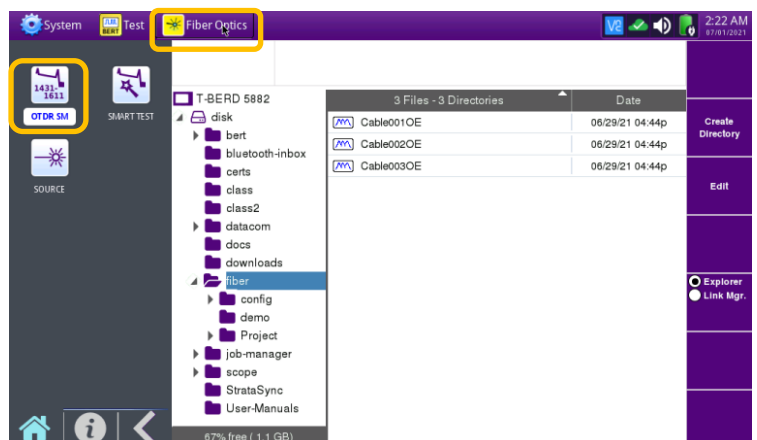


Figure 5: Fiber Optics Home Screen

QUICK CARD

CONFIGURE TEST

1. Tap the **Setup** soft key .
2. Tap **Display** and set **Distance Unit** to your desired unit of measure.
3. Tap **Acquisition** and configure the following basic settings for the trace:
 - ▶ **Laser:** Select the wavelength to test.
 - ▶ **Acquisition Mode:**
 - Select **Manual** to manually to enter Range and Pulse width settings.
 - Select **Auto** to automatically configure Range, Pulse width, and Resolution settings.
 - Select **SmartAcq** to perform an acquisition with a short pulse width, followed by an acquisition with a longer pulse width. The first acquisition allows events at the beginning of the fiber to be detected more precisely.
 - ▶ **Acq. Time:** Select Realtime, Auto or the desired time to sample the fiber.
 - ▶ **Launch Cable:** Select and enter **Length** if you are using a Launch Cable. Enter 20 meters or 66 feet for Viavi supplied 20-meter launch cables.
4. Tap **Alarms** and configure pass/fail criteria:
 - ▶ Set **Alarm Level** to **Fail**.
 - ▶ Set **Threshold** to **Default**, or select alternate alarm thresholds (TIA-568.3, User, etc.)

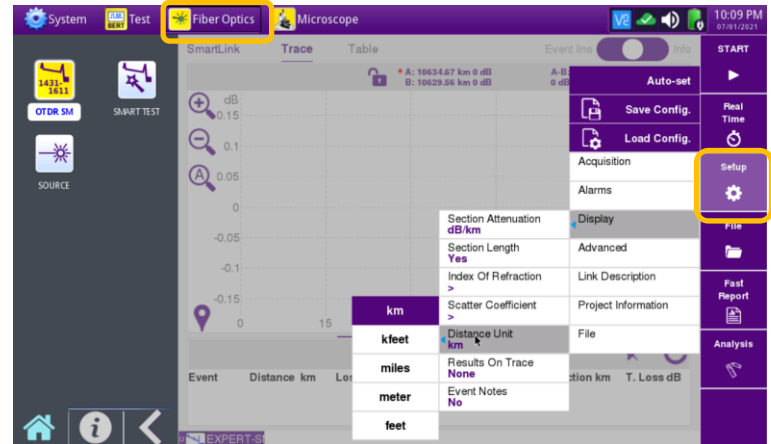


Figure 6: Setup, Display

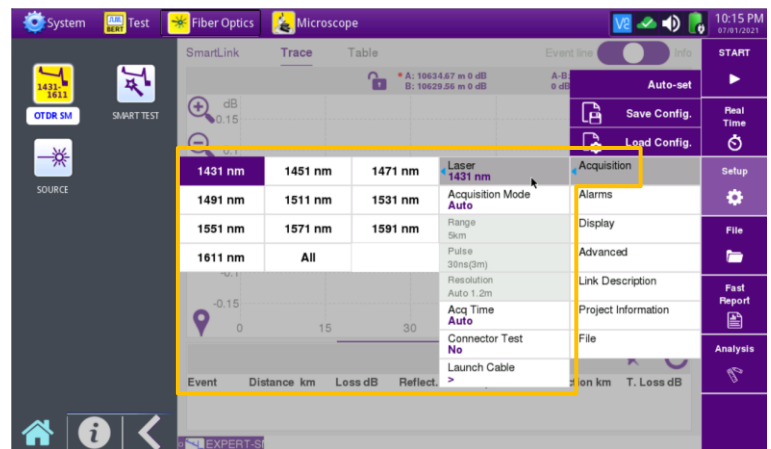


Figure 7: Setup, Acquisition

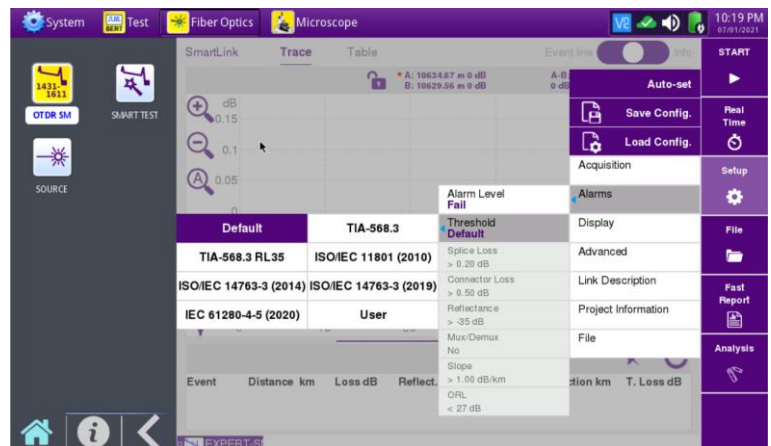


Figure 8: Setup, Alarms

QUICK CARD

RUN TEST

1. Press the Start soft key  to start the test. After auto-configuration, the OTDR will perform a connection check to ensure that the connection is **Good**. If the Connection is **Bad**, disconnect the launch cable, and reconnect as described on pages 1 and 2, cleaning every fiber that fails the inspection test.
2. The OTDR will perform an acquisition at the configured wavelength.

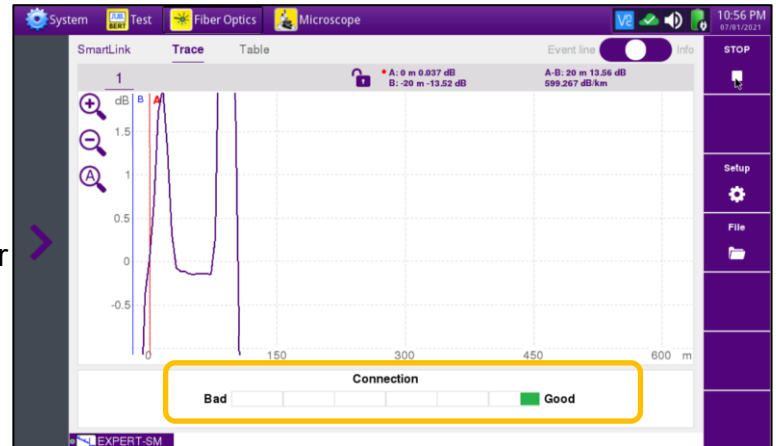


Figure 9: Connection Check

VIEW SMARTLINK MAP

1. Tap the **SmartLink** tab at the left screen top to select SmartLink view.
2. Set the toggle switch at the right screen top to **Event Line**.
3. View SmartLink results:
 - The FUT is displayed as a series of icons representing events (Mux, Demux, splices, bends, connectors, etc.) and distances. Swipe left or right to view additional icons on spans with more than 4 events.
 - The center of the display shows summary results for the entire span for each acquisition or wavelength. Tap any event in the upper display to view detailed results for that specific event.
 - Events are marked with a green check or red **x** based on the Alarms setting.

Note: the icon-based view may not be available on older T-BERD/MTS 5800s when acquisition Mode = SmartAcq. Rerun the test with the **Mode = Auto** or contact VIAVI to upgrade your unit to add this feature.

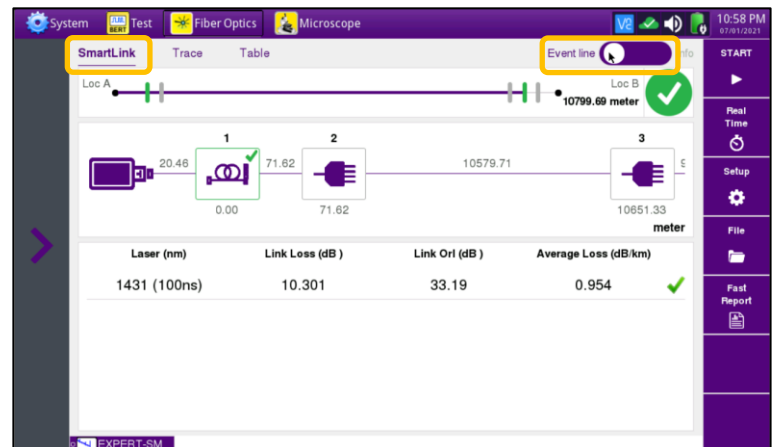


Figure 10: SmartLink View, Summary Results

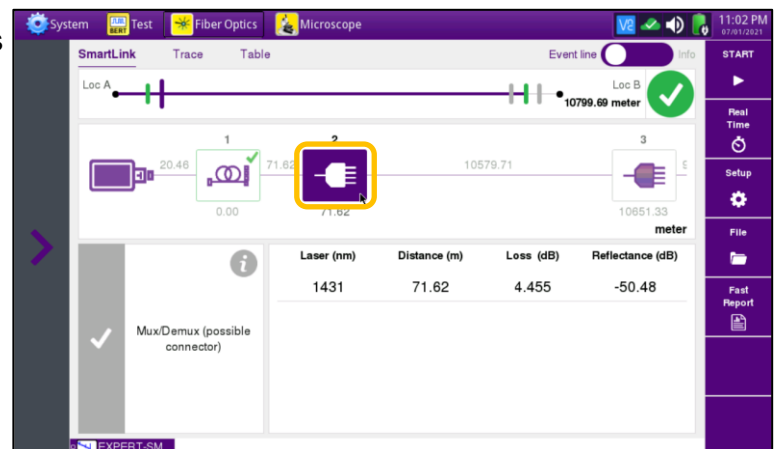


Figure 11: SmartLink View, Event Results

QUICK CARD

VIEW TRACE

1. Tap the **Trace** tab at the left screen top to select **Trace view**.
2. Set the toggle switch at the screen top to **Info**.
3. Tap  to auto-zoom.
4. View trace results:
 - ▶ Trace information is shown in the upper display.
 - ▶ Graphical results (dB versus distance) are shown in the center display.
 - ▶ A color-coded **Event table** is shown in the lower display. Swipe up and down to view all events.

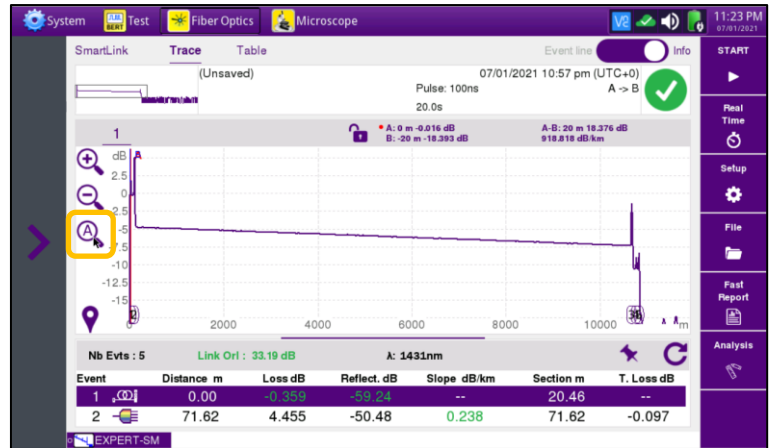


Figure 12: Trace view

VIEW TABLE

1. Tap the **Table** tab at the left screen top to select Table view.
2. Set the toggle switch at the right screen top to the center (off) position.
3. View table results:
 - ▶ Distance, Loss, and Reflectance are shown for each event.
 - ▶ Tap the toggle switch to view All events or Failed events.

Event	Distance (m)	Loss (dB)	Reflectance (dB)
1	0.00	-0.359	-59.24
2	71.62	4.455	-50.48
3	71.48	4.435	-51.08
4	10629.56	3.25	-49.13
5	10726.57	0.325	-60.64
6	10777.62	--	-57.06

Figure 13: Table view

QUICK CARD

FAST REPORT

1. Tap the **File** soft key  and tap the **fiber** folder.
2. Tap the **Create Directory** soft key  and enter a name for your new folder. All trace files will be saved to this directory.
3. Tap the **Exit** soft key .

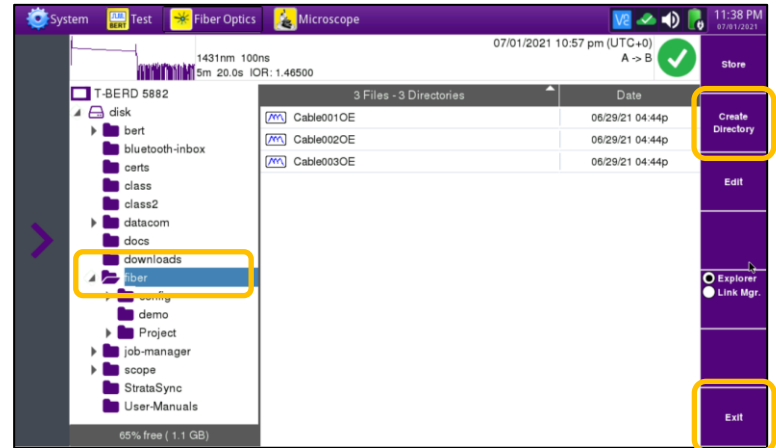


Figure 14: File Explorer

4. Tap the **Fast Report** soft key  and enter **Cable ID, Fiber Number, Locations, Direction, and Save Mode**.
5. Tap **Save**.
6. Tap  to accept the default filename and save test results.
7. Tap the **Fast Report** soft key again to return to the results display.
8. Tap  to return to the OTDR Home screen.

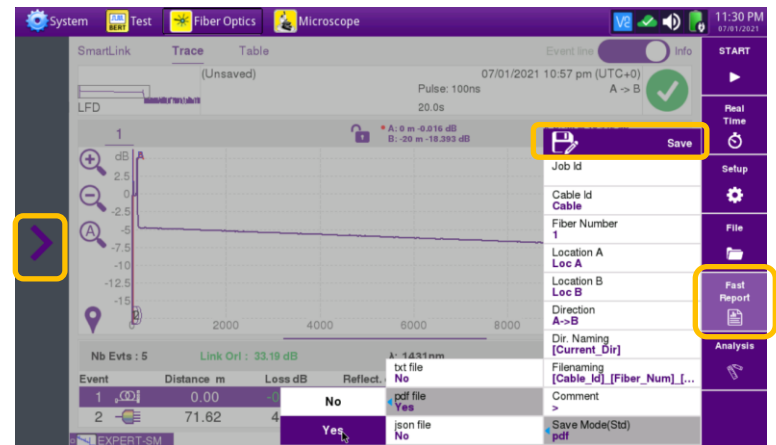


Figure 15: Fast Report